

managing risk with responsibility

Jeffrey S. Moquin, Director Risk Management Department Telephone: 754-321-3200 Facsimile: 754-321-3290

May 30, 2007	Signature on File	For Custodial Supervisor Use Only			
TO:	Ms. Marina Rashid,, Principal Eagle Ridge Elementary School	Custodial Issues Addressed Custodial Issues Not Addressed			
FROM:	Robert Krickovich, Coordinator, LEA Facilities and Construction Management				
SUBJECT:	Indoor Air Quality (IAQ) Assessment FISH 213				

On March 16, 2007 I conducted an assessment of FISH 213 at Eagle Ridge Elementary School. This evaluation included observations of the flooring system, ceiling tiles, false ceiling plenum, environmental surfaces, interior and exterior walls, and the accessible ventilation equipment. Additionally, environmental parameter measurements were taken to include temperature, relative humidity, and carbon dioxide. The detailed findings, along with the recommended corrective action can be found on the attached IAQ Assessment Worksheets.

The IAQ assessment did identify one or more existing conditions impacting IAQ and has generated appropriate work orders to correct deficiencies in systems and maintenance that could contribute to decreased indoor air quality. At the time of the assessment, these concerns were not an immediate health or safety concern to building occupants. However, due to individual sensitivities and predisposing health factors, it is possible that some building occupants may elicit a health response to agents and / or conditions identified during the evaluation. Therefore, to further improve IAQ, prevent development of future IAQ-related problems, and to reduce the potential for IAQ-related complaints by building occupants, the IAQ Assessment Team recommends appropriate follow up of each item identified and listed in the attached evaluation.

Please ensure that your Head Facilities Serviceperson receives a copy of this correspondence so that the recommendations requiring their attention can be addressed. Within two weeks a representative from the Custodial/Grounds Department will conduct a follow-up visit to ensure that all issues have been appropriately addressed.

Should any questions arise, or if the current concerns continue after the attached recommendations have been addressed, please feel free to contact me at 754-321-1638.

cc: Dr. Joanne Harrison, Area Superintendent Craig Anderson, Area Director Jeffrey S. Moquin, Director, Risk Management Paul Bach, Project Manager, Facilities and Construction Management Ruby Fitzgerald, Broward Teachers Union Roy Jarrett, National Federation of Public and Private Employees Mark Dorsett, Manager 1, Physical Plant Operations Division, Zone 1 Roy Norton, Manager Custodial/Grounds, Physical Plant Operations Division

RK/tc Enc.

	IAQ Assessment		sessment	Location Number		3441		
Eagle Ridge Elementary School				Evaluat	tion Requested	March	13, 2007	
Time of Day	10:00 am				I	Evaluation Date	March	16, 2007
Outdoor Condition	ons Temj	perature 7	9.1	Relative Humidit	y 65. 1	Ambie	nt CO2	492
Fish Te	emperature R	ange Relat	tive Humidity	Range	CO2	Ran	ige #	Occupants
213	67 7 2	2 - 78	52.2	30% - 60%	523	Max 700	> Ambien	t 2
Noticeable Odor No Visible water Visible microbial Amount of material damage / staining? growth? affected								
Ceiling Type	2 x 4 Lay I	n	Νο	No			None	
Wall Type	Drywall/Tackb	oard	No	No			None	
Flooring	12 x 12 Vin	yl	No	No			None	
Ceiling	Clean Yes	Minor Dust / Debris No	Needs Cleaning No		Corre	ctive Action Re	equired	
Walls	Yes	No	No					
Flooring	Yes	Νο	No					
HVAC Supply G	rills No	Yes	Yes		Clean wit	th Wexcide dis	infectant	
HVAC Return G	rills Yes	No	No					
Ceiling at Suppl Grills	y No	Yes	Yes		Cle	an as appropri	ate	
Surfaces in Roo	m No	Yes	Yes		Cle	an as appropri	ate	

Observations

Findings:

- Dust and debris on HVAC supply grills and on ceiling fixture lenses at supply grills

- Minor dust build up on elevated surfaces

- Throw rugs are stained

- Sink backsplash needs to be caulked and/or repaired

- Appears to be water intrusion along window wall (papers behind cabinet are wet)

- Heavy dust and debris on filter in range hood

- FISH 213A - Exhaust fan is restroom is not operational

- FISH 214A - AHU Room - Filter spacers are missing and air is bypassing filters. Drain pan is holding water and there is minor dust and debris build up on inside of unit.

- Temperature was low at the time of the assessment

-Recommendations:

Site Based Maintenance:

- Clean HVAC supply grills with Wexcide disinfectant solution and clean ceiling fixture lenses at supply grills as appropriate

- Thoroughly clean elevated surfaces

- Thoroughly clean or replace throw rugs

- Adjust the thermostat to increase the temperature. Continue to monitor condition and initiate a work order for Physical Plant Operations to evaluate the HVAC system if temperature does not improve.

- Continue to monitor this location for any signs of microbial growth as well as dust and debris accumulation and clean as appropriate

Physical Plant Operations:

- Evaluate sink backsplash and caulk and/or repair as appropriate

- Remove cabinet at window wall and clean debris from behind cabinet and properly seal window to prevent water intrusion.

- FISH 213A - Repair restroom exhaust fan

- FISH 214A - Replace missing filter spacers and clean inside of unit pan and condensate drain