

managing risk with responsibility

Aston A. Henry, Director	
Risk Management Departmer	nt

 Telephone:
 754 321-1900

 Fax:
 754 321-1917

September 1	0, 2013 Signature on File	For Custodial Supervisor Use Only
TO:	Catrice Duhart, Principal Annabel C. Perry Elementary School	Custodial Issues Addressed Custodial Issues Not Addressed
FROM:	Richard Rosa, Project Manager Risk Management Department	
SUBJECT:	Indoor Air Quality (IAQ) Assessment	· · · · · · · · · · · · · · · · · · ·

On August 30, 2013, I conducted an assessment at **Annabel C. Perry Elementary School**. Attached are findings and recommendations for further assessment, remediation, or corrective actions needed.

The IAQ assessment did identify one or more existing conditions impacting IAQ and has generated appropriate work orders to correct deficiencies in systems and maintenance that could contribute to decreased indoor air quality. At the time of the assessment, these concerns were not an immediate health or safety concern to building occupants. However, due to individual sensitivities and predisposing health factors, it is possible that some building occupants may elicit a health response to agents and / or conditions identified during the evaluation. Therefore, to further improve IAQ, prevent development of future IAQ-related problems, and to reduce the potential for IAQ-related complaints by building occupants, the IAQ Assessment Team recommends appropriate follow up of each item identified and listed in the attached evaluation.

Please ensure that your Head Facilities Serviceperson receives a copy of this correspondence so that the recommendations requiring their attention can be addressed. In an attempt to separate IAQ issues from general maintenance items, the attached assessment may contain direction for site based staff to generate a work order through COMPASS. Within two weeks a representative from the Custodial/Grounds Department will conduct a follow-up visit to ensure that all site based custodial issues have been appropriately addressed.

Should any questions arise, or if the current concerns continue after the attached recommendations have been addressed, please feel free to contact us at 754-321-1907.

cc: Shelley Meloni, Task Assigned Chief Facilities & Construction Officer, Facilities & Construction Mark Dorsett, Manager, Zone 1, Physical Plant Operations Division Roy Norton, Manager, Custodial/Grounds, Physical Plant Operations Division Aston Henry, Director, Risk Management Sonja Coley, Senior Project Manager, Facilities & Construction Broward Teachers Union Federation of Public Employees

RR/tc Enc.

	IAQ As	sessment		
Perry, Annab	el C. Elementary Evaluati	on Date August 30, 2013	Time of Day 9:30	
Outdoor Conditions Ten	nperature 79.7 Re	elative Humidity 87.4	Ambient CO2 449	
FishTemperatureP-989C77.7	RangeRelative Humidit72 - 7852.0	y Range CC 30% - 60% 119		
Noticeable Odor No Ceiling 2' x 4' Walls Homasote / Tackb	Visible water damag staining?	ge / Visible microbial growth? No Yes	Amount of material affected < 1 sq ft	
Floor 12" x 12" Vinyl		No		
Ceiling CleanNoWalls CleanNoFlooring CleanYesRoom SurfacesNoCleanYes	HVAC Supply Grills Clean Inside of Sup Duct Clean Ceiling at Su Grills Clean	oply N/A		No V/A
Trash RemovedYesSigns of PestsYesRoom ClutteredYes	Exhaust Fans Wor Drain Traps Food if Stored in Roo in Sealed Containers	wet N/A		No No
Mechanical Equipment Loca Filters Installed Properly Condensate Pan Clean	tion Window unit No Filters C N/A Cooling Coil C			N/A N/A
Fresh Air Intake Location Pollutant Sources Near Air Intake	Window unit Grass and landscape	▼▼	Fresh Air Intake Free of Obstruction	ſes

Observations

Visible stained ceiling tile in restroom-recommend roofers to evaluate the area over the restroom. Visible microbial growth under North HVAC unit and on restroom walls. There is also a strip of tack board to the right of the North window HVAC unit that needs replacing, wet per moisture meter, must remove fire alarm to replace tack board. Check exterior wall and repair if necessary. Ants were visible on window sills and adjacent to East exterior door. Evaluate weather stripping on East door frame. Only one window unit is operational, check work orders for repair status of the South HVAC unit.

Corrective Actions to be Completed by Site Based Staff

Replace stained ceiling tiles after roofing repairs	▼
Vacuum/wexcide window unit grills	▼
Clean restroom exhaust fan grill	▼
Generate a work order for pest control	▼
Remove and replace A/C filters	▼
Clean dust build up on restroom walls	▼
Clean dust build up on window sills	▼
	▼

Corrective Actions to be Completed by PPO

Evaluate and repair cause of stained ceiling tiles	
Evaluate and repair cause of stamed centing thes	•
Clean both window unit coils	▼
Evaluate and repair cause of water damage	▼
Remove and replace material as necessary	▼
Repair South HVAC unit/check work order status	▼
	▼
	▼
	▼